

Agilent U1251A/U1252A Handheld Digital Multimeter

Data Sheet





Features

- 50,000 count dual display
- Up to 0.025% basic DC voltage accuracy
- · True RMS measurement
- J-type and K-type temperature measurements
- Data storage capability with optional IR-USB link to PC
- 20 MHz frequency counter
- Programmable square wave generator
- –20 °C to +55 °C operating temperature
- Safety certified with EN/IEC 61010-1 Category III 1000 V overvoltage protection
- Built-In battery charger capability
- Multi function tilt stand

Introduction

The Agilent U1250A series Handheld Digital Multimeter gives you 4.5 digit resolution with a 50,000 count full scale and basic DC voltage accuracy of up to 0.025%. These features give you the flexibility to perform quick validation measurements or perform tolerance checks and marginal failure troubleshooting. It also offers True RMS, dBm, and AC+DC readings to measure both sinusoidal and non-sinusoidal waveforms accurately.

Versatile functionality

The U1250A series Handheld Digital Multimeter delivers many features that you would expect from a benchtop multimeter. These instruments come with all the basic measurement functions and added functionality needed in today's changing maintenance environment such as temperature measurements, frequency measurement with % readout, 20 MHz frequency counter (U1252A only), and dBm measurements.

More than just a measurement tool

The U1250A series expands users' capability beyond typical measurements. These instruments provide data storage capability which can be done both

manually or automatedly with the optional PC interface cable. The accompanying Agilent Graphical User Interface (GUI) further extends the potential of these instruments by allowing you to customize your data logging needs. Other features include sophisticated math functions that allow users to manipulate the data obtained. The U1252A can be used as a programmable square wave generator that allows you to stimulate electronic circuits for debugging purposes.

Uncompromising ruggedness and safety

Use The U1250A series Handheld Digital Multimeter with confidence in almost any environment. These instruments come in a robust package with shock absorbing overmold and operate within their rated specifications from -20 °C right up to +55 ^oC. Furthermore, these instruments are rated at Cat III 1000 V (IEC 61010 Compliant) which allows you to confidently make measurements on building electrical installations, at locations between the main circuit breaker and the mains socket-outlets, including measurements performed on equipment that is permanently connected to the mains circuits.

Visit <u>www.agilent.com</u> for more information on Agilent's Data Acquisition products.



U1251A/U1252A DC SPECIFICATIONS

FUNCTION	RANGE	RESOLUTION	TEST CURRENT/	ACCURACY ± (% of rea	ding + No. of Least Significant Digit)
FUNCTION	KANGE	RESULUTION	BURDEN VOLTAGE	U1251A	U1252A
	50.000 mV	0.001 mV	-	0.05 + 50(2)	$0.05 + 50^{(2)}$
	500.00 mV	0.01 mV	-		
	1000.0 mV	0.1 mV	-		0.025 + 5
VOLTAGE ⁽¹⁾	5.0000 V	0.0001 V	-	0.03 + 5	0.025 + 5
	50.000 V	0.001 V	-	0.00 1 0	
	500.00 V	0.01 V	-		0.03 + 5
	1000.0 V	0.1 V	-		0.05 + 5
	500.00 Ω ⁽³⁾	0.01 Ω	1.04 mA	0.08 +10	0.05 + 10
	5.0000 k $\Omega^{(3)}$	0.0001 kΩ	416 μΑ		
	50.000 kΩ	0.001 kΩ	41.2 μΑ	0.08 + 5	0.05 + 5
RESISTANCE	500.00 kΩ	0.01 kΩ	4.12 μΑ		
NESIS IAINGE	5.0000 M Ω	0.0001 MΩ	375 nA	0.2 + 5	0.15 +5
	50.000 M $\Omega^{(4)}$	0.001 MΩ	187 nA	1 + 10	1 + 5
	500.00 M $Ω^{(4)}$	0.01 MΩ	187 nA	N/A	$3 + 10 < 200 \text{ M}\Omega/8 + 10 > 200 \text{ M}\Omega$
	500.00 nS ⁽⁵⁾	0.01 nS	187 nA	1 + 20	1 + 10
	500.00 μΑ	0.01 μΑ	0.06 V (100 Ω)	0.1 + 5 ⁽⁶⁾	0.05 + 5 ⁽⁶⁾
	5000.0 μΑ	0.1 μΑ	0.6 V (100 Ω)	0.1 + 5(*)	0.05 + 5(*)
CURRENT	50.000 mA	0.001 mA	0.09 V (1 Ω)	0.2 + 5 ⁽⁶⁾	0.15 + 5 ⁽⁶⁾
CUNNEINI	440.00 mA	0.01 mA	0.9 V (1 Ω)	0.2 + 5(*)	0.15 + 5(4)
	5.0000 A	0.0001 A	0.2 V (0.01 Ω)	0.3 + 10	0.3 + 10
	10.000 A ⁽⁷⁾	0.001 A	0.4 V (0.01 Ω)	0.5 + 10	0.3 + 5
DIODE TEST	-	0.1 mV	1.04 mA		0.05 + 5

TEMPRATURE SPECIFICATIONS

FUNCTION	THERMOCOUPLE TYPE	RANGE	RESOLUTION	ACCURACY ± (% of reading + offset error)
TEMPERATURE	К	-200 ~ 1372 °C/ -328 ~ 2502 °F	0.1 °C/0.1 °F	0.3% + 3 °C/ 0.3% + 6 °F
TEWN ENATORE	J(8)	-210 ~ 1200 °C/ -346 ~ 2192 °F	0.1 °C/0.1 °F	0.3% + 3 °C/ 0.3% + 6 °F

CAPACITANCE SPECIFICATIONS

FUNCTION	RANGE	RESOLUTION	ACCURACY ± (% of reading + No. of Least Significant Digit)	MEASURING RATE AT FULL SCALE	MAX. DISPLAY	
	10.000 nF	0.001 nF	1% + 8			
	100.00 nF	0.01 nF				
	1000.0 nF	0.1 nF		4 times/sec.		
CAPACITANCE	10.000 μF	0.001 μF	1% + 5		11000	11000 counts
CAFACITANCE	100.00 μF	0.01 μF	170 + 3		11000 Counts	
	1000.0 μF	0.1 μF		1 time/sec.		
	10.000 mF	0.001 nF		0.1 times/sec.		
	100.00 mF	0.01 nF	3% + 10	0.01 times/sec.		

- [1] Input impedance: >1G Ω for 50 mV~1000 mV ranges. For U1251A, input impedance is 10 M Ω (nominal) for 5 V~1000 V ranges. For U1252A, input impedance is 10 M Ω (nominal) in parallel with 1.1 M Ω at dual display.
- [2] The accuracy could be 0.05%+10 for U1251A and 0.05%+5 for U1252A. Always use NULL function to zero out the thermal effect before measuring the signal.
- [3] The accuracy of 500 Ω and 5 k Ω is specified after NULL function, which is used to subtract the test lead resistance and the thermal effect
- [4] For the range of 50 M Ω and 500 M Ω , the R.H. is specified for <60%.
- [5] The accuracy is specified for <50 nS and after NULL function with open test lead.
- [6] Always use NULL function to zero out thermal effect with open test lead before measuring the signal. If NULL function is not used, an additional 20 counts needs to be added to the DC current accuracy. Thermal effect could occur due to the following:
- Wrong operation to measure the high voltage of $50 \text{ V} \sim 1000 \text{ V}$ for resistance, diode, and mV measurements.
- · After battery-charging has completed.
- · After measuring a current greater than 440 mA, it is suggested that the meter be left to cool down for twice the measuring time used.
- [7] Current can be measured up to 10 A continuously. An additional 0.5% needs to be added to the specified accuracy if the signal measured is in the range of 10 A \sim 20 A for 30 seconds maximum. After measuring a current of > 10 A, leave the meter to cool down for twice the measuring time used before application of low current measurement.
- [8] Only available in U1252A.

U1251A AC SPECIFICATIONS

FUNCTION	RANGE	RESOLUTION	ACCI	URACY ± (% of reading + No. of Least Significant Digit) FREQUENCY			
			30 Hz ~ 45 Hz	45 Hz ~ 1 kHz	1 kHz ~ 10 kHz	10 kHz ~ 30 kHz	
	50.000 mV	0.001 mV		0.6+40	1.0+40	1.6+60	
	500.00 mV	0.01 mV			1.0+40	1.0+00	
TRUE DAGG AG	1000.0 mV	0.1 mV			1.0+25	1.6+40	
TRUE RMS AC VOLTAGE	5.0000 V	0.0001 V	1.0+60	0.6+25			
VOLIAGE	50.000 V	0.001 V					
	500.00 V	0.01 V				1.6+40 ⁽¹⁾	
	1000.0 V	0.1 V		0.6+40	1.0+40	N/A	

FUNCTION	RANGE	RESOLUTION	ACCURACY ± (% of reading + No. of Least Significant Digit) FREQUENCY			
			30 Hz ~ 45 Hz	45 Hz ~ 2 kHz	2 kHz ~ 20 kHz	
	500.00 μA ⁽²⁾	0.01 μΑ	1.5+50		3.0+80	
	5000.0 μΑ	0.1 μΑ	1.5+40		3.0+60	
A O OLIDDENIT	50.000 mA	0.001 mA		0.8+20		
AC CURRENT	440.00 mA	0.01 mA				
	5.0000 A	0.0001 A	0.0.40(4)		3+60,	
	10.000 A ⁽³⁾	0.001 A	2.0+40(4)		<3 A/5 kHz	

U1252A AC SPECIFICATIONS

FUNCTION	RANGE	RESOLUTION		ACCURACY \pm (% of reading + No. of Least Significant Digit) FREQUENCY					
			30 Hz ~ 45 Hz	45 Hz ~ 1 kHz	1 kHz ~ 10 kHz	10 kHz ~ 20 kHz	20kHz~100kHz ⁽⁵⁾		
	50.000 mV	0.001 mV		0.4+40	0.7+40				
	500.00 mV	0.01 mV		0.4+25	0.4+25	0.75+40			
TRUE BASE AS	1000.0 mV	0.1 mV					3.5+120		
TRUE RMS AC VOLTAGE	5.0000 V	0.0001 V	1.5+60						
VOLIAGE	50.000 V	0.001 V							
	500.00 V	0.01 V				1.5+40	3.5+120 ⁽¹⁾		
	1000.0 V	0.1 V	7 [0.4+40	0.4+40	1.5+40 ⁽¹⁾	N/A		

FUNCTION	RANGE	DECOLUTION	ACCURA	· No. of Least Significa UENCY	nt Digit)	
		RESOLUTION	30 Hz ~ 45 Hz	45 Hz ~ 1 kHz	1 kHz ~ 20 kHz	20kHz~100kHz ⁽⁵⁾
	500.00 μA ⁽²⁾	0.01 μΑ				50.00
	5000.0 μΑ	0.1 μΑ	1.0.20	0.7+20	0.75+20 5.0-	
AC CURRENT	50.000 mA	0.001 mA	1.0+20			5.0+80
AC CONNEIVI	440.00 mA	0.01 mA			1.5+20	
	5.0000 A	0.0001 A	1.5+20(4)		3+60,	N/A
	10.000 A ⁽³⁾	0.001 A	1.5+20(+/		<3 A/5 kHz	IV/A

^[1] The input signal is lower than the product of 20,000,000 V-Hz (product of voltage and frequency).

^[2] Input current >35 mArms.

^[3] Current can be measured from 2.5 A up to 10 A continuously. An additional 0.5% needs to be added to the specified accuracy if the signal measured is in the range of 10 A \sim 20 A for 30 seconds maximum. After measuring a current of >10 A, leave the meter to cool down for twice the measuring time used before application of low current measurement.

^[4] Input current < 3 Arms.

^[5] The additional error to be added as frequency >20 kHz and signal input<10% of range: 3 counts of LSD per kHz.

U1252A AC+DC SPECIFICATIONS

FUNCTION	RANGE	RESOLUTION		ACCURACY ± (% of reading + No. of Least Significant Digit) FREQUENCY				
			30 Hz ~ 45 Hz	45 Hz ~ 1 kHz	1 kHz ~ 10 kHz	10 kHz ~ 20 kHz	20kHz~100kHz ⁽¹⁾	
	50.000 mV	0.001 mV	1.5+80	0.4+60	0.7+60	0.8+60	3.5+220	
	500.00 mV	0.01 mV		0.4+30	0.4+30	0.8+45	3.5+125	
TRUE DAGE AG	1000.0 mV	0.1 mV	7					
TRUE RMS AC VOLTAGE	5.0000 V	0.0001 V	1.5+65					
VOLIAGE	50.000 V	0.001 V	1.5+05					
	500.00 V	0.01 V				1.5+45	3.5+125 ⁽²⁾	
	1000.0 V	0.1 V	7	0.4+45	0.4+45	1.5+45 ⁽²⁾	N/A	

FUNCTION	RANGE	RESOLUTION	ACCURACY ± (%	gnificant Digit)			
			30 Hz ~ 45 Hz	45 Hz ~ 1 kHz			
	500.00 μA ⁽³⁾	0.01 μΑ	1 1 . 25	0.8+25	0.8+25		
	5000.0 μA 0.1 μA 1.1+25	1.1+25	0.0+20	0.0+20			
AC CURRENT	50.000 mA	0.001 mA	1.2+25	0.9+25	0.9+25		
AC CONNEIVI	440.00 mA	0.01 mA	1.2+20	0.9+20	U.9+25		
	5.0000 A	0.0001 A	1.8+30(5)	0.9+30	3.3+70,		
	10.000 A ⁽⁴⁾	0.001 A	1.8+30(4)	0.9+25	<3 A/5 kHz		

U1251A/U1252A FREQUENCY SPECIFICATIONS(2)

RANGE	RESOLUTION	ACCURACY \pm (% of reading + No. of Least Significant Digit)	MINIMUM INPUT FREQUENCY
99.999 Hz	0.001 Hz		
999.99 Hz	0.01 Hz	0.000/ 0	
9.9999 kHz	0.001 k0Hz	0.02%+3	1 Hz
99.999 kHz	0.001 kHz	<600 kHz	
999.99 kHz	0.01 kHz		

^[1] The additional error to be added as frequency >20 kHz and signal input <10% of range: 3 counts of LSD per kHz.

U1251A FREQUENCY SENSITIVITY DURING VOLTAGE MEASUREMENT

FREQUENCY SENSITIVITY AND TRIGGER LEVEL FOR U1251A									
INPUT RANGE		MINIMUM SENSITIVITY (R.M.S. Sine-Wave)		R DC COUPLING					
(Maximum input for specified accuracy = 10 x Range or 1000 V)	20 Hz - 100 kHz	>100 kHz ~ 200 kHz	< 100 kHz	>100 kHz ~ 200 kHz					
50.000 mV	10 mV	15 mV	10 mV	15 mV					
500.00 mV	25 mV	35 mV	60 mV	70 mV					
1000.0 mV	40 mV	50 mV	100 mV	150 mV					
5.0000 V	0.25 V	0.5 V	0.5 V / 1.25 V (< 100 Hz)	0.6 V					
50.000 V	2.5 V	5 V	5 V	6 V					
500.00 V	25 V	N/A	50 V	N/A					
1000.0 V	50 V	N/A	300 V	N/A					

^[2] The input signal is lower than the product of 20,000,000 V-Hz (product of voltage and frequency).

^[3] Input current >35 mArms.

^[4] Current can be measured from 2.5 A up to 10 A continuously. An additional 0.5% needs to be added to the specified accuracy if the signal measured is in the range of 10 A \sim 20 A for 30 seconds maximum. After measuring a current of >10 A, leave the meter to cool down for twice the measuring time used before application of low current measurement.

^[5] Input current < 3 Arms.

U1252A FREQUENCY SENSITIVITY DURING VOLTAGE MEASUREMENT

	FREQUENCY SENSITIVITY AND TRIGGER LEVEL FOR U1251A									
INPUT RANGE		SENSITIVITY Sine-Wave)	TRIGGER LEVEL FOR DC COUPLING							
(Maximum input for specified accuracy = 10 x Range or 1000 V)	20 Hz-200 kHz	>200 kHz ~ 500 kHz	< 100 kHz	>100 kHz ~ 500 kHz						
50.000 mV	10 mV	25 mV	10 mV	25 mV						
500.00 mV	70 mV	150 mV	70 mV	150 mV						
1000.0 mV	120 mV	300 mV	120 mV	300 mV						
5.0000 V	0.3 V	1.2 V	0.6	1.5 V						
50.000 V	3 V	5 V	6 V	15 V						
500.00 V	30 V < 100 kHz	N/A	60 V	N/A						
1000.0 V	50 V < 100 kHz	N/A	120 V	N/A						

DUTY CYCLE(1)

MODE	RANGE	ACCURACY AT FULL SCALE
DC Coupling	0.01% ~ 99.99%	0.3% per kHz + 0.3%

PULSE WIDTH(1)

MODE	RANGE	ACCURACY AT FULL SCALE
500 ms	0.01 ms	0.2% + 3
2000 ms	0.1 ms	0.2% + 3

^[1] Positive or negative pulse width must be greater than 10 ms and the range of duty cycle should be considered. The range of pulse width is determined by the frequency of the signal.

U1251A/U1252A FREQUENCY SENSITIVITY DURING CURRENT MEASUREMENT

INPUT RANGE	MINIMUM SENSITIVITY (R.M.S. Sine-Wave) 20 Hz-20 kHz
500.00 μΑ	100 μΑ
5000.0 μA	250 μΑ
50.000 mA	10 mA
440.00 mA	25 mA
5.0000 A	1 A
10.000 A	2.5 A

PEAK HOLD (Capturing changes)

SIGNAL WIDTH	ACCURACY FOR DC mV/VOLTAGE/CURRENT
Single event > 1 ms	2% + 400 for all ranges
Repetitive > 250 µs	2% + 1000 for all ranges

U1252A FREQUENCY COUNTER SPECIFICATIONS

Divide 1 (secondary display "-1-")

RANGE	RESOLUTION	ACCURACY ± (% of reading + No. of Least Significant Digit)	SENSITIVITY	MIN. INPUT FREQUENCY
99.999 Hz	0.001 Hz	0.02% + 3		
999.99 Hz	0.01 Hz	0.002% + 3, < 2 MHz	100 mV R.M.S.	
9.9999 kHz	0.0001 kHz		TOU HIV N.IVI.S.	0.5 Hz
99.999 kHz	0.001 kHz			0.5 112
999.99 kHz	0.01 kHz		200 mV R.M.S.	
9.9999 MHz	0.0001 MHz		200 IIIV N.IVI.S.	

Divide 100 (secondary display "-100-")

RANGE	RESOLUTION	ACCURACY ± (% of reading + No. of Least Significant Digit)	SENSITIVITY	MIN. INPUT FREQUENCY
9.9999 MHz	0.0001 MHz	0.002% + 5,	400 mV R.M.S.	1 MHz
99.999 MHz	0.001 MHz	< 20 MHz	600 mV R.M.S.	I IVII IZ

U1252A SQUARE WAVE OUTPUT

OUTPUT ⁽¹⁾	RANGE	RESOLUTION	ACCURACY
FREQUENCY	0.5, 1, 2, 5, 10, 15, 20, 25, 30, 40, 50, 60, 75, 80, 100, 120, 150, 200, 240, 300, 400, 480, 600, 800, 1200, 1600, 2400, 4800 Hz	0.01 Hz	0.005% + 2
DUTY CYCLE ⁽²⁾	0.39% ~ 99.60%	0.390625%	0.4% of full scale ⁽³⁾
PULSE WIDTH ⁽²⁾	1/Frequency	Range/256	0.2 ms + Range/256
AMPLITUDE	Fixed 0 ~ +2.8 V	0.1 V	0.2 V

^[1] Output impedance: 3.5 k Ω maximum.

OPERATING CHARACTERISTICS Measuring rate

Function	Times/second
ACV	7
ACV + dB	7
DCV	7
AC + DC V	2
Ω /nS	14
Diode	14
Capacitance	4 (< 100 μF)
DCI	7
ACI	7
AC + DC I	2
Temperature	6
Frequency	2 (> 10 Hz)
Duty cycle	1 (> 10 Hz)
Pulse width	1 (> 10 Hz)

DECIBEL (dB) CALCUALTION

dB BASE	REFERENCE	DEFAULT REFERENCE
1 mΩ (dBm)	1-9999 Ω	50 Ω
1 V (dBV)	1 V	1 V

GENERAL SPECIFICATIONS

DISPLAY

Both primary and sceondary displays are 5 digit on the LCD display. Both the primary and secondary displays offer a maximum resolution of 50,000 counts. Automatic polarity indication.

POWER CONSUMPTION

105 mVA / 420 mVA (with backlit) maximum (U1251A) 165 mVA / 480 mVA (with backlit) maximum (U1252A)

OPERATING ENVIRONMENT

Full accuracy at -20 °C to 55 °C

Full accuracy to 80% RH for temperature up to 35 °C, decreasing linearly to 50% RH at 55 °C

Altitude:

0 - 2000 meters per IEC 61010-1 2nd Edition CAT III, 1000 V 2000 - 3000 meters per IEC 61010-1 2nd Edition CAT III, 600 V

STORAGE COMPLIANCE

-40 °C to 70 °C

SAFETY COMPLIANCE

Certified by CSA for IEC/EN/CSA/UL 61010-1 2nd Edition and CAN/CSA 22.2 61010-1 2nd Edition.

MEASUREMENT CATEGORY

CAT III 1000 V Overvoltage Protection up to 2000m, Pollution degree 2

EMC COMPLIANCE

Certified to IEC/EN 61326: 2002, CISPR 11, and equivalents for Group 1, Class A

COMMON MODE REJECTION RATIO (CMRR)

> 90 dB at DC, 50/60 Hz + 0.1% (1k Ω ubalanced)

NORMAL MODE REJECTION RATIO (NMRR)

> 60 dB at DC, 50/60 Hz + 0.1%

TEMPERATURE COEFFICIENT

0.15 * (specified accuracy)/°C (from 20 °C to 18 °C or 28 °C to 55 °C)

SHOCK and VIBRATION

Tested to IEC/EN 60068-2

DIMENSION (WxDxH)

203.5 mm x 94.4 mm x 59.0 mm

WEIGHT

- 504±5 g with battery (U1251A)
- 527±5 g with battery (U1252A)

CHARGING TIME (only U1252)

<220 minutes approx. at the environment of 10 °C to 30 °C.

WARRANTY

1 year factory + 2 years extended warranty

^[2] The positive or negative pulse width must be greater than 50 ms for adjusting the duty cycle or pulse width under different frequency. Else, the accuracy and range will be different from the definition.

^[3] For signal frequencies greater than 1 kHz, an addition of 0.1% per kHz is added to the accuracy.


Accessories included:

- Soft carrying case
- Alkaline 9 V Battery (U1251A only)
- Rechargeable Ni-MH battery with power adaptor provided (U1252A only)
- U1160A Standard Test Lead Kit
- Quick Start Guide
- Reference CD containing the User's Guide, application software and instrument drivers
- Certificate of Calibration (CoC)
- Test Report

Optional Accessories (sold seperately):

- U1161A Extension test lead kit
- U1173A IR to USB cable
- U1180A Thermocouple lead kit

DIMENSION

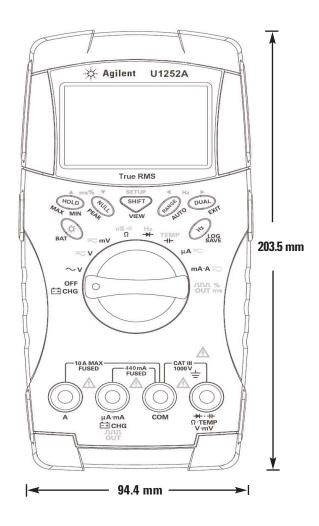



Agilent Email Updates

www.agilent.com/find/emailupdates

Get the latest information on the products and applications you select.



Agilent Direct

www.agilent.com/find/agilentdirect

Quickly choose and use your test equipment solutions with confidence.



www.agilent.com/find/open

Agilent Open simplifies the process of connecting and programming test systems to help engineers design, validate and manufacture electronic products. Agilent offers open connectivity for a broad range of system-ready instruments, open industry software, PC-standard I/O and global support, which are combined to more easily integrate test system development.

Remove all doubt

Our repair and calibration services will get your equipment back to you, performing like new, when promised. You will get full value out of your Agilent equipment throughout its lifetime. Your equipment will be serviced by Agilent-trained technicians using the latest factory calibration procedures, automated repair diagnostics and genuine parts. You will always have the utmost confidence in your measurements.

Agilent offers a wide range of additional expert test and measurement services for your equipment, including initial start-up assistance onsite education and training, as well as design, system integration, and project management.

For more information on repair and calibration services, go to

www.agilent.com/find/removealldoubt

www.agilent.com

For more information on Agilent Technologies' products, applications or services, please contact your local Agilent office. The complete list is available at:

www.agilent.com/find/contactus

Phone or Fax

United States:

(tel) 800 829 4444 (fax) 800 829 4433

Canada:

(tel) 877 894 4414 (fax) 800 746 4866

China:

(tel) 800 810 0189 (fax) 800 820 2816

Europe:

(tel) 31 20 547 2111

Japan:

(tel) (81) 426 56 7832 (fax) (81) 426 56 7840

Korea:

(tel) (080) 769 0800 (fax) (080) 769 0900

Latin America:

(tel) (305) 269 7500

Taiwan:

(tel) 0800 047 866 (fax) 0800 286 331

Other Asia Pacific Countries:

(tel) (65) 6375 8100 (fax) (65) 6755 0042 Email: tm_ap@agilent.com Contacts revised: 09/26/05

Product specifications and descriptions in this document subject to change without notice.

© Agilent Technologies, Inc. 2006, 2007 Printed in USA, January 31, 2007 5989-5509EN

